XT130C - XT131C - XT130D - XT131D Dead band digital controllers with multi probe input

1. GENERAL WARNING

1.1 APLEASE READ BEFORE USING THIS MANUAL

- This manual is part of the product and should be kept near the instrument for easy and quick reference.
- The instrument shall not be used for purposes different from those described hereunder. It cannot be used as
 a safety device.
- Check the application limits before proceeding.

1.2 A SAFETY PRECAUTIONS

- Check the supply voltage is correct before connecting the instrument.
- Do not expose to water or moisture: use the controller only within the operating limits avoiding sudden temperature changes with high atmospheric humidity to prevent formation of condensation
- Warning: disconnect all electrical connections before any kind of maintenance.
- The instrument must not be opened.
- In case of failure or faulty operation send the instrument back to the distributor or to "DIXELL S.p.A" (see address) with a detailed description of the fault.
- · Consider the maximum current which can be applied to each relay (see Technical Data).
- Ensure that the wires for probes, loads and the power supply are separated and far enough from each other, without crossing or intertwining.
- In case of applications in industrial environments, the use of mains filters (our mod. FT1) in parallel with inductive loads could be useful.

2. GENERAL DESCRIPTION

The XT130C, XT131C and XT130D, XT131D (DIN RAIL format) are dead band ON/OFF controllers for temperature, humidity and pressure applications. They have been developed and designed for applications in the industrial sector where the process variable must be maintained constant within a fixed band. The analogue input type can be set by parameter between the following, according to the model:

- PTC NTC
- PTC, NTC, Pt100, Thermocouple J, K, S;
- 4÷ 20mA, 0÷ 1V, 0÷ 10V.

3. FIRST INSTALLATION 3.1 PROBE SETTING


The pre-set probe type is written on the label of the instrument, see picture. If it is different from the probe that has be used, set the probe following procedure below.

3.1.1 How to set the probe.

- Enter the programming menu by pressing the SET+ ✓ for 3s.
- 2. Select the Pbc (Probe configuration) parameter and push the SET key.
- 3. Set the kind of probe:
 - a. Controller for temperature: Pt= Pt100, J = J thermocouple, c = K thermocouple, S = S thermocouple: Ptc = PTC: ptc = ntc
 - b. Controller with current or voltage inputs: cur=4÷20mA, 0-1= 0÷1V, 10= 0÷10V
- Push the SET key to confirm it.
- Switch the controller off and on again.

NOTE: Before proceeding check and, if necessary; set with appropriate values the Minimum Set Points (LS1 e LS2) and Maximum Set Points (US1 e US2). See also the paragraphs concerning the programming.

4. REGULATIONS




- Two stage ON/OFF control with DEAD BAND
- Relay 1 output at inverse action (heating, humidifying, increasing pressure): load 1 CUT IN is "SET-db", load 1 CUT OUT is when the process variable reaches the set point.
- Relay 2 output at direct action (cooling, de- humidifying, decreasing pressure): load 2 CUT IN is "SET+db", load 2 CUT OUT is when the process variable reaches the set point.

5. FRONT PANEL COMMANDS



SET: To display and modify target set point; in programming mode it selects a parameter or confirm an operation.

TO SWITCH THE INSTRUMENT ON/OFF: If the function is enabled (par. onF=yES), by pressing the SET key for more than 4s the controller is switched OFF. To switch the instrument on again

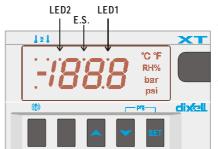

- press the SET key.
- UP: in programming mode it browses the parameter codes or increases the displayed value. Hold it pressed for a faster change
- ▼ DOWN: in programming mode it browses the parameter codes or decreases the displayed value. Hold it pressed for a faster change

KEY COMBINATIONS:

- ★ + ▼ To lock & unlock the keyboard.
- SET + ▼ To enter in programming mode
- SET + A To return to the room temperature display.

5.1 USE OF LEDS

A series of light points on the front panels is used to monitor the loads controlled by the instrument. Each LED function is described in the following table.

LED	MODE	FUNCTION		
	ON	Output1 relay enabled		
Ţ	ON	Output2 relay enabled		
LED1	Flashing	- Programming Phase (flashing with LED2)		
LED2	Flashing	- Programming Phase (flashing with LED1)		
E.S.	ON	Energy saving activated by digital input		
	ON	- ALARM signal		
		- In "Pr2" indicates the parameter is also present in "Pr1"		

5.2 TO SEE THE SETPOINT



- Push and release the SET key to see the Set point value;
- . To come back to the normal display push again the SET key or wait 10s.

5.3 TO CHANGE THE SETPOINT



- 1. Hold pushed the SET key for 3s to change the Set point value;
- The value of the set point will be displayed and the LED1 & 2 start blinking;
- To change the Set value push the ▲ or ▼ arrows within 10s.
 To memorise the new set point value push the SET key again or wait 10s.

5.4 TO ENTER THE PARAMETERS LIST "PR1

To enter the parameter list "Pr1" (user accessible parameters) operate as follows:



- 1. Push for 3s the SET + ✓ keys (LED1 & 2 start blinking).
- 2. The controller will display the first parameter present in the Pr1 menu..



5.5 TO ENTER THE PARAMETERS LIST "PR2"

The "Pr2" parameter list contains the configuration parameters. A security code is required to enter it

- 1. Enter the "Pr1" level, see above paragraph
- 2. Select "Pr2" parameter and press the "SET" key.
- 3. The "PAS" flashing message is displayed, shortly followed by "0 --" with a flashing zero.
- Use ▲ or ▼ to input the security code in the flashing digit; confirm the figure by pressing "SET".

The security code is "321".

If the security code is correct the access to "Pr2" is enabled by pressing "SET" on the last digit

Another possibility is the following:

After switching ON the instrument, within 30 seconds, push SET + ▼ keys together for 3s: the Pr2 menu will be entered.

5.6 HOW TO MOVE A PARAMETER FROM THE "PR2" MENU TO "PR1" AND VICEVERSA.

Each parameter present in "Pr2" MENU can be removed or put into "Pr1", user level, by pressing "SET + \checkmark ".

In "Pr2" when a parameter is present in "Pr1" the LED ((1)) is on.

5.7 HOW TO CHANGE A PARAMETER

To change a parameter value operates as follows:

- 1. Enter the **Programming mode**
- Select the required parameter.
- 3. Press the "SET" key to display its value.
- 4. Use "**UP**" or "**DOWN**" to change its value.
- 5. Press "SET" to store the new value and move to the following parameter.

TO EXIT: Press SET + UP or wait 15s without pressing a key.

NOTE: the set value is stored even when the procedure is exited by waiting the time-out to expire.

5.8 HOW TO LOCK THE KEYBOARD



- Keep pressed for more than 3 s the the ▲ and ▼ keys.
- The "POF" message will be displayed and the keyboard will be locked. At this point it will be possible only to see the set point or the MAX o Min temperature stored
- If a key is pressed more than 3s the "POF" message will be displayed.

5.9 TO UNLOCK THE KEYBOARD

Keep pressed together for more than 3s the the ▲ and ▼ keys, till the "Pon" message will be displayed.

5.10 ON/OFF FUNCTION

TO SWITCH THE INSTRUMENT ON/OFF: If the function is enabled (par. onF=yES), by pressing the SET key for more than 4s the controller is switched OFF. To switch the instrument on again press the SET key.

6. PROBES AND MEASURING RANGE				
Probe	Down Scale	Full Scale		
NTC	-40°C/-40°F	110°C / 230 °F		
PTC	-50°C / -58°F	150°C / 302°F		
Pt100	-200°C / -328°F	600°C / 1112°F		
TcK	0°C/32°F	1300°C / 1999°F		
TcJ	0°C/32°F	600°C / 1112°F		
TcS	0°C/32°F	1400°C / 1999°F		

LIST OF PARAMETERS

REGULATION

- db dead band width: (0.1÷Full Scale) this is the band below and above the set point beyond which the relay 1 respectively relay 2 are enabled. Once a output is enabled, it remains ON until the set point is reached.
- LS1 Minimum set point: (Down Sc. Set) Sets the minimum acceptable value for the set point.
- US1 Maximum set point: (Set+ Full Sc.) Sets the maximum acceptable value for set point.
- AC Anti-short cycle delay: (0÷250 sec) Minimum time between the switching off and the following switching on
- on Minimum time a stage stays switched ON (0÷250 sec)
- ono: Minimum time between 2 following switching ON of the same load (0÷120 min)

ALARMS

- ALC Temperature alarms configuration: it determines if alarms are relative to set point or referred to absolute values
 - rE relative to set point; Ab absolute temperature
- ALL Minimum alarm:

with ALC=rE: relative to set point, (0÷|Down Sc.-Set|) this value is subtracted from the set point. The alarm signal is enabled when the probe values goes below the "SET-ALL" value. with ALC=Ab absolute value, minimum alarm is enabled when the probe values goes below the "ALL" value.

ALU Maximum alarm:

- with ALC=rE: alarm relative to set point, (0÷|Full Sc.-Set|) Maximum alarm is enabled when the probe values exceeds the "SET+ALU" value.
- with ALC=Ab: absolute alarm, (Set÷Full Sc.) Maximum alarm is enabled when the probe values exceeds the "ALU" value.
- ALH Differential for alarm recovery: (0,1÷Full scale) the alarm recovers when probe value is higher than Alarm value + ALH.
- ALd Alarm delay:(0÷999 min) time interval between the detection of an alarm condition and alarm signalling.
- dAO Delay of alarm at start-up: (0÷23.5h) time interval between the detection of the alarm condition after instrument power on and alarm signalling.
- So1 Relay status with faulty probe: So1=oFF open; So1=on closed.
- So2 Output 2 status with faulty probe: So1=oFF open; So1=on closed
- tbA Status of alarm relay after pushing a key. (XT131C/ XT131D only): oFF = relay disabled; on = relay enabled.
- AS Alarm relay configuration (XT131C only): cL = 4-6 terminals open with alarm; oP = 4-6 terminals closed with alarm.

PROBES AND DISPLAY

- LCI Start of scale, only with current or voltage input: (with rES = in, dE, cE: -99.00÷199.00, with rES=irE -999÷1999) Adjustment of read out corresponding to 4mA or 0V input signal.
- UCI End of scale, only with current or voltage input (with rES = in, dE, cE: -99.00 ÷ 199.00, with rES=irE -999÷1999) Adjustment of read out corresponding to 20mA or 1V or 10V input signal.
- oPb Probe calibration: (-999÷999) allows to adjust possible offset of the probe.
- rES Resolution: select the resolution of the controller.

in= integer (-99÷199);

dEC= 1 decimal point (-99.0÷199.0),

cE = 2 digits after the decimal point (-99.00÷199.00) only for current or voltage input,

irE = integer, large scale (-999÷1999) only for current or voltage input.

WARNING: if rES is changed from "irE" to another value, all the parameters values expressed in degrees: SET, db, LS1, uS1, ALL, ALu, ALH, LCi, uCi, LAo, uAo, HES, have to be checked and set.

NOTE: the decimal point selection is not available on models with thermocouple input.

UdM Measurement unit: it depends on models:

for temperature: °C = Celsius; °F = Fahrenheit.

with 4÷20mA, 0÷1V, 0÷10V input : 0= °C; 1= °F, 2= %RH, 3=bar, 4=PSI, 5=no measurement unit

- PbC Probe selection: it sets the kind of probe. It depends on models
 - for temperature NTC/PTC: Ptc = PTC; ntc = ntc.
 - for temperature standard: Pt= Pt100, J = J thermocouple, c = K thermocouple, S = Sthermocouple: Ptc = PTC: ntc = ntc.
 - with 4÷20mA, 0÷1V, 0÷10V input : cur=4÷20mA, 0-1= 0÷1V, 10= 0÷10V.
- P3F Third wire presence for Pt100 probe: for using 2 or 3 wires Pt100 probes: no = 2 wires probe; yES = 3 wires probe

ANALOG OUTPUT - ONLY FOR XT130D, XT131D - OPTIONAL

AOC Analog output configuration: (only for models with analog output)

AOC=Pb Probe reading. The analog output parameters LAO and UAO are indipendent and correspond to the absolute read-out probe signal.

AOC=Er Probe - Set Point1. The analog output parameters LAO and UAO are related to the difference between measurement of the probe and Set Point

- LAO Lower analog output limit: (only for models with analog output) minimum value of temperature associated to the 4mA analog output. This value can be absolute or relative to the Set Point by setting the AOC parameter.
- UAO Upper analog output limit: (only for models with analog output) maximum value of temperature associated to the 20mA analog output. This value can be absolute or relative to the Set Point by setting the AOC parameter
- SAO Analog output safety with probe fault: (only for models with analog output) determines what state the analog output should assume when the probe is faulty:
 - SAO = oFF; analog output = 4mA
 - SAO = on; analog output = 20mA

DIGITAL INPUT

- HES Set point change during during the Energy Saving cycle: (Down Sc./Full Sc.) sets the variation of the set point during the Energy Saving cycle
- **Digital input operating mode:** configure the digital input function: **c-H** = NOT USED; oFF = to switch the controller off.; AUS = Not used; HES = Energy Saving; EAL = generic external alarm; bAL = serious external alarm: it switches off the loads.
- Digital input polarity:
 - CL: the digital input is activated by closing the contact;
 - OP: the digital input is activated by opening the contact
- did Digital input alarm delay: (0÷255 min) delay between the detection of the external alarm condition (i1F = EAL or i1F = bAL) and its signalling.

OTHER


- Adr RS485 serial address (0÷247) identifies the instrument within a control or supervising system
- onF Swithching ON/OFF enabling from keyboard: (no = disabled; yES=enabled) It permits the switching OFF of the instrument by pressing the SET key for more than 4s.
- Ptb Parameters table: (read only) Shows the code of the parameters map.
- rEL Software release: (read only)
- Pr2 To access the Pr2 parameter programming menu.

INSTALLATION AND MOUNTING

Instrument XT130C and XT131C shall be mounted on vertical panel, in a 29x71 mm hole, and fixed using the special brackets supplied.

To obtain an IP65 protection grade use the front panel rubber gasket (mod. RG-C). Instruments XT130D, XT131D, shall be mounted on an omega DIN rail

The temperature range allowed for correct operation is 0÷60 °C. Avoid places subject to strong vibrations, corrosive gases, excessive dirt or humidity. The same recommendations apply to probes. Let air circulate by the cooling holes.



ELECTRICAL CONNECTIONS

The instruments are provided with screw terminal block to connect cables with a cross section up to 2,5 mm². Before connecting cables make sure the power supply complies with the instrument's requirements. Separate the input connection cables from the power supply cables, from the outputs and the power connections. Do not exceed the maximum current allowed on each relay, in case of heavier loads use a suitable external relay.

SERIAL CONNECTIONS

All models can be connected to the monitoring and supervising system XJ500 using the serial port. The external XJ485 serial module to interface the instrument with the monitoring and supervising system XJ500 is required.

The standard ModBus RTU protocol it is used.

NOTE: XT130C or XT131C instruments with current or voltage input and 230V or 115V supply, cannot be connected to the XJ485 serial module.

11. HOW TO USE THE HOT KEY

HOW TO PROGRAM A HOT KEY FROM THE INSTRUMENT (UPLOAD) 11.1

- Program one controller with the front keypad.
- When the controller is \underline{ON} , insert the "Hot key" and push \blacktriangle key; the "uPL" message 2. appears followed a by flashing "End"
- 3 Push "SET" key and the End will stop flashing.
- Turn OFF the instrument remove the "Hot Key", then turn it ON again.

NOTE: the "Err" message is displayed for failed programming. In this case push again A key if you want to restart the upload again or remove the "Hot key" to abort the operation.

HOW TO PROGRAM AN INSTRUMENT USING A HOT KEY (DOWNLOAD)

- Insert a programmed "Hot Key" into the 5 PIN receptacle and then turn the Controller

- Automatically the parameter list of the "Hot Key" is downloaded into the Controller memory, the "doL" message is blinking followed a by flashing "End".
- After 10 seconds the instrument will restart working with the new parameters.
- Remove the "Hot Key"...

NOTE the message "Err" is displayed for failed programming. In this case turn the unit off and then on if you want to restart the download again or remove the "Hot key" to abort the operation.

12. DIGITAL INPUT

The controllers have 1 free contact digital input. It is programmable in 5 different configurations by the "11F" parameter.

12.1 REMOTE ON/OFF (I1F = OFF)

This function allows to switch ON and OFF the instrument.

12.2 GENERIC ALARM (I1F = EAL)

As soon as the digital input is activated the unit will wait for "did" time delay before signalling the "EAL" alarm message. The outputs status don't change. The alarm stops just after the digital input is de-activated.

12.3 SERIOUS ALARM MODE (I1F = BAL)

When the digital input is activated, the unit will wait for "did" delay before signalling the "bAL" alarm message. The relay outputs are switched OFF. The alarm will stop as soon as the digital input is de-activated.

12.4 ENERGY SAVING (I1F = HES)

The Energy Saving function allows to change the set point value as the result of the SET+ HES (parameter) sum. This function is enabled until the digital input is activated.

13. ALARM SIGNALS					
Message	Cause	Outputs			
	Probes broken or absence	Alarm output ON; Output according to parameter "So1"			
"PFc"	Probe short circuited	Alarm output ON; Output according to parameter "So1"			
	Maximum alarm	Alarm output ON; Other outputs unchanged.			
	Minimum alarm	Alarm output ON; Other outputs unchanged.			
"EAL"	External alarm	Output unchanged.			
"bAL"	Serious external alarm	Output OFF.			

13.1 ALARM RELAY STATUS

Status of the instrument	XT131C		XT131D	
	AS = CL	AS= oP	AS = CL	AS= oP
Instrument off	5-6 closed	5-6 closed	23-24 closed	23-24 closed
Normal operating	5-6 closed	5-6 open	23-24 closed	23-24 open
Alarm present	5-6 open	5-6 closed	23-24 open	23-24 closed

13.2 SILENCING BUZZER / ALARM RELAY OUTPUT

Once the alarm signal is detected the buzzer, if present, can be disabled by pressing any key. XT131C/ XT131D: the alarm relay status depends on the tbA parameter: with tbA=yES the relay is disabled by pressing any key, with tbA=no the alarm relay remains enabled as long as the alarm lasts. The display signal remains as long as the alarm condition remains.

13.3 ALARM RECOVERY

Probe alarms "PFo", "PFc" start few seconds after the fault in the probe; they automatically stop few seconds after the probe restarts normal operation. Check connections before replacing the probe. Max. and min. alarms "HA" and "LA" automatically stop as soon as the variable returns to normal values. Alarms "bAL" and "EAL" recover as soon as the digital input is disabled.

14. TECHNICAL DATA

Housing: self extinguishing ABS.

Case: XT130C, XT131C frontal 32x74 mm; depth 60mm;

XT130D, XT131D: 4 DIN modules 70x85 mm; depth 61mm.

Mounting: XT130C, XT131C panel mounting in a 71x29 mm panel cut-out.

XT130D, XT131D: DIN RAIL

Protection: IP20.

Frontal protection: XT110C, XT111C IP65 with frontal gasket RG-C (optional).

Frontal protection: IP65 with frontal gasket RG-C (optional). Connections: Screw terminal block $\leq 2,5 \text{ mm}^2$ heat-resistant wiring.

Power supply: 12Vac/dc, $\pm 10\%$ or: $24\text{Vac/dc} \pm 10\%$

or 230Vac \pm 10%, 50/60Hz or 110Vac, \pm 10%, 50/60Hz

Power absorption: 3VA max.

Display: 3 ½ digits, red LED Inputs: according to the order: NTC/PTC or NTC/PTC /Pt100 /Thermocouple J, K, S or 4÷20mA/

0÷1V / 0÷10V

Relay outputs: Output1: relay 8(3)A, 250Vac

Output2: relay 8(3)A, 250Vac

Alarm: (XT131C / XT131D) relay 8(3)A, 250Vac

Kind of action: 1B; Pollution grade: normal, Software class: A.


Other output: buzzer (optional), Data storing: on the non-volatile memory (EEPROM). Operating temperature: $0 \div 60 \degree C$ ($32 \div 140 \degree F$); Storage temperature: $-30 \div 85 \degree C$ ($-22 \div 185 \degree F$).

Relative humidity: 20÷85% (no condensing)

Measuring and regulation range: according to the probe Controller Accuracy a 25°C: better than $\pm 0.5\%$ of full scale


15. CONNECTIONS

15.1 XT130C - 12V AC/DC OR 24V AC/DC

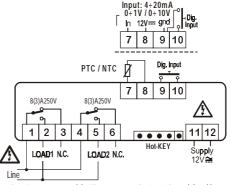


Probe: Pt100= 7 - 9 (8); Thermocouple J, K, S = 7(+); 9(-) 24Vac/cd supply: 11-12

15.2 XT130C - 230V AC OR 115V AC

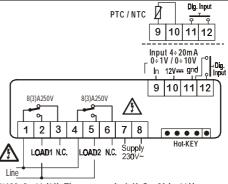


Pt100=9 -11 (10); Thermocouple J, K, S = 9(+) - 11(-) 115Vac supply: 7-8

15.3 XT131C - 12VAC/DC OR 24VAC/DC

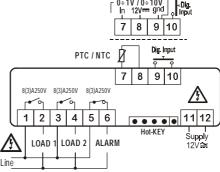


Probe: Pt100= 7 - 9 (8); Thermocouple J, K, S = 7(+); 9(-) 24Vac/cd supply: 11-12

15.4 XT131C - 230V AC OR 115V AC

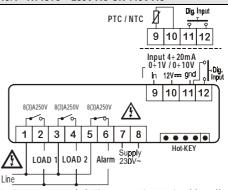


Probe: Pt100=9-11 (10); Thermocouple J, K, S=9(+)-11(-) 115Vac supply: 7-8

15.5 XT130D - 230V AC OR 120V AC OR 24V AC

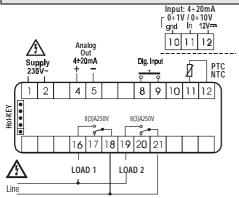

Probe: Pt100=11 - 10 (12); Thermocouple J, K, S= 11(+) - 10(-) 115Vac supply: 1-2; 24Vac supply: 1-2

15.6 XT131D - 230V AC OR 115V AC OR 24V AC

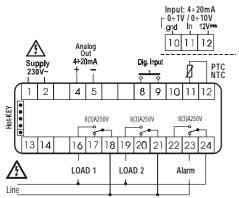

Probe: Pt100=11 - 10 (12); Thermocouple J, K, S= 11(+) - 10(-) 115Vac supply: 1-2; 24Vac supply: 1-2

10.	DEFAULT SETTING VALUES						
COD	Name	Range	°C/°F	Lev			
Set	Set point	LS1÷US1	0/32	-			
db	Dead band	-Full Sc./ Full Sc.	1/2	Pr1			
LS1	Minimum set point	Down Sc./ Set	min	Pr2			
US1	Maximum set point	Set/ Full Sc.	max	Pr2			
S1C	Action type output	in= Inverse; dir=direct	in	Pr2			
Ac	Anti-short cycle delay:	0÷250 sec	0	Pr2			
on	Minimum time a stage stays switched ON	0÷250 sec	0	Pr2			
ono	Minimum time between 2 following switching ON of the same load	0÷120 min	0	Pr2			
ALC	Alarm configuration	rE=relat.; Ab= absolute	rE	Pr2			
ALL	Minumum alarm (ALC=rE) (ALC=Ab)	0 ÷ Start ScSet Start Sc.÷ ALu	10.0/ 20	Pr2			
ALU	Maximum alarm (ALC=rE) (ALC=Ab)	0 ÷ Full ScSet . ALL÷ Full Scale	10.0/ 20	Pr2			
ALH	Alarm recovery differential	0÷Full scale	2.0/4	Pr2			
ALd	Alarm delay	0÷999 min	15	Pr2			
dAO	Alarm delay at start up	0÷23h 50min	1.3	Pr2			
So1	Output1 status with faulty pr.	oFF=open on=closed	oFF	Pr2			
So2	Output2 status with faulty pr.	oFF=open on=closed	oFF	Pr2			
tbA1	Alarm relay disabling	no; yES	yES	Pr2			
AS1	Alarm relay polarity	CL÷0P	οP	Pr2			
Lci ²	Start scale with current or voltage input	-1999÷1999	various	Pr1			
Uci ²	End scale with current or voltage input	-1999÷1999	various	Pr1			
OPb	Probe calibration	-Full Sc./ Full Sc.	0.0	Pr1			
rES	Resolution	in=NO; dE=0,1; cE=0,01	in	Pr2			
UdM	Measurement unit (temp.) (current/voltage)	°C=°C; °F= °F; 0=°C; 1=°F; 2=RH; 3=bar; 4=PSI, 5=off	various	Pr1			
	Kind of probe	Pt=Pt100; J=tcJ; c= tck; S=tcS; Ptc=PTC; ntc= NTC; 0-1=0÷1V; 10= 0÷10V; cur=0÷20mA	various	Pr1			
P3F	3 rd wire presence	no=2 wires; yES=3 wires	no	Pr2			
Aoc ³	Analog output configuration	Pb = probe; Er = Probe-Set1	Pb	Pr2			
LAo3		Down Sc	various	Pr2			
	Upper An. Output limit	Full sc.	various	Pr2			
SAo ³	· ····································	on; oFF	oFF	Pr2			
HES	Energy saving differential Down Sc./ Full Sc.		0	Pr2			
i1F	Digital input configuration	c-H / oFF / AuS / HES / EAL / bAL	EAL	Pr2			
i1P	Digital input polarity	cL=closed; oP=open	cL	Pr2			
did	Alarm delay for dig. input	0÷120m	0	Pr2			
Adr	Serial address	0÷247	1	Pr2			
OnF	oFF function enabling	no=not enabled; yES=enabled	no	Pr2			
Ptb	Parameter table	Readable only		Pr2			
rEL	Software release	Readable only		Pr2			
Pr2	To access the Pr2	Readable only	321	Pr1			

¹ Only for XT131C/ XT131D; ² Only for instrument with 4÷20mA or 0÷1V or 0÷10V

³ Only for instrument analog output